

City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

Potomac River Condition Assessment

PREPARED FOR: City of Alexandria, CH2M Hill

PREPARED BY: Michael Baker Jr., Inc.

DATE: January 12, 2015 (Revised May 26, 2015)

Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within the Potomac River watershed was completed. In total, 178 storm sewer structures were inspected. This included 93 manholes, 72 inlets, 11 I/O structures, and 2 control devices. In addition, 345 storm sewer pipe segments were inspected. This Technical Memorandum summarizes the results of the field investigations in the Potomac River watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in the Potomac River watershed for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in the watershed. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.

Table 1 – SCREAM Defect Categories

Defect Category	Score Range	Example
None	0	n/a
Few	1-20	Infiltration weeper
Minimum	21-40	Manhole cracks less than 1/8"
Moderate	41-60	Spalling of chamber wall, large infiltration flow
Major	61-80	Large cracks in cover or frame
Extreme	81-100	Collapsed Pipe

Structure Inspections

As part of this inspection task, 178 storm structures were inspected in the Potomac River watershed. Figure 1 shows the number of structures within each defect category identified in the previous section. Figure 2 shows the geographic location of each structure within the Potomac River watershed, color coded to its defect category.

The average condition score of the storm structures was 29 (“Minimum” defect category). About 40% of the structures inspected had no observed defects. About 14 percent of the Potomac River structures ranked in the “Few” and “Minimum” defect categories (scores 1-40); approximately 34 percent of the structures had defects in the “Moderate” category; and around 12 percent of the structures had defects in the “Major” category. None of the inspected Potomac River structures are ranked in the “Extreme” category. The highest structure score was 78.

There were 57 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field, or access unavailable). This included 30 structures within the Potomac River watershed for which physical attributes were determined from the most recent construction drawings. These 57 structures are not included in Figure 1 or Figure 2. Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

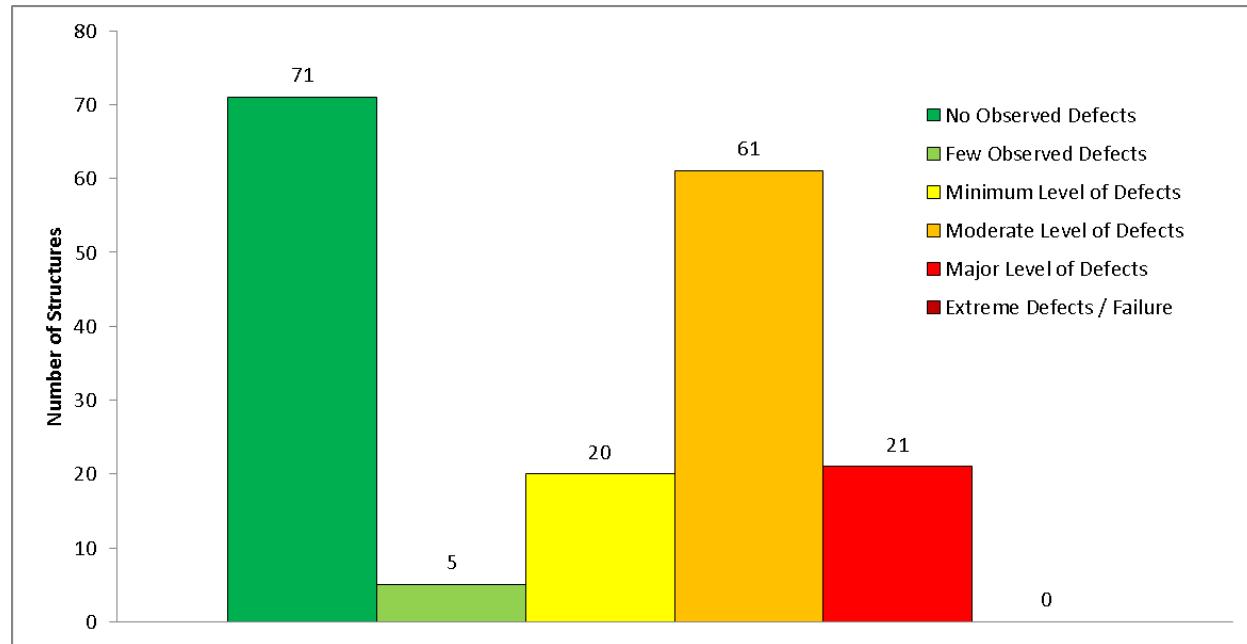


Figure 1. Structure Inspection Summary.

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).


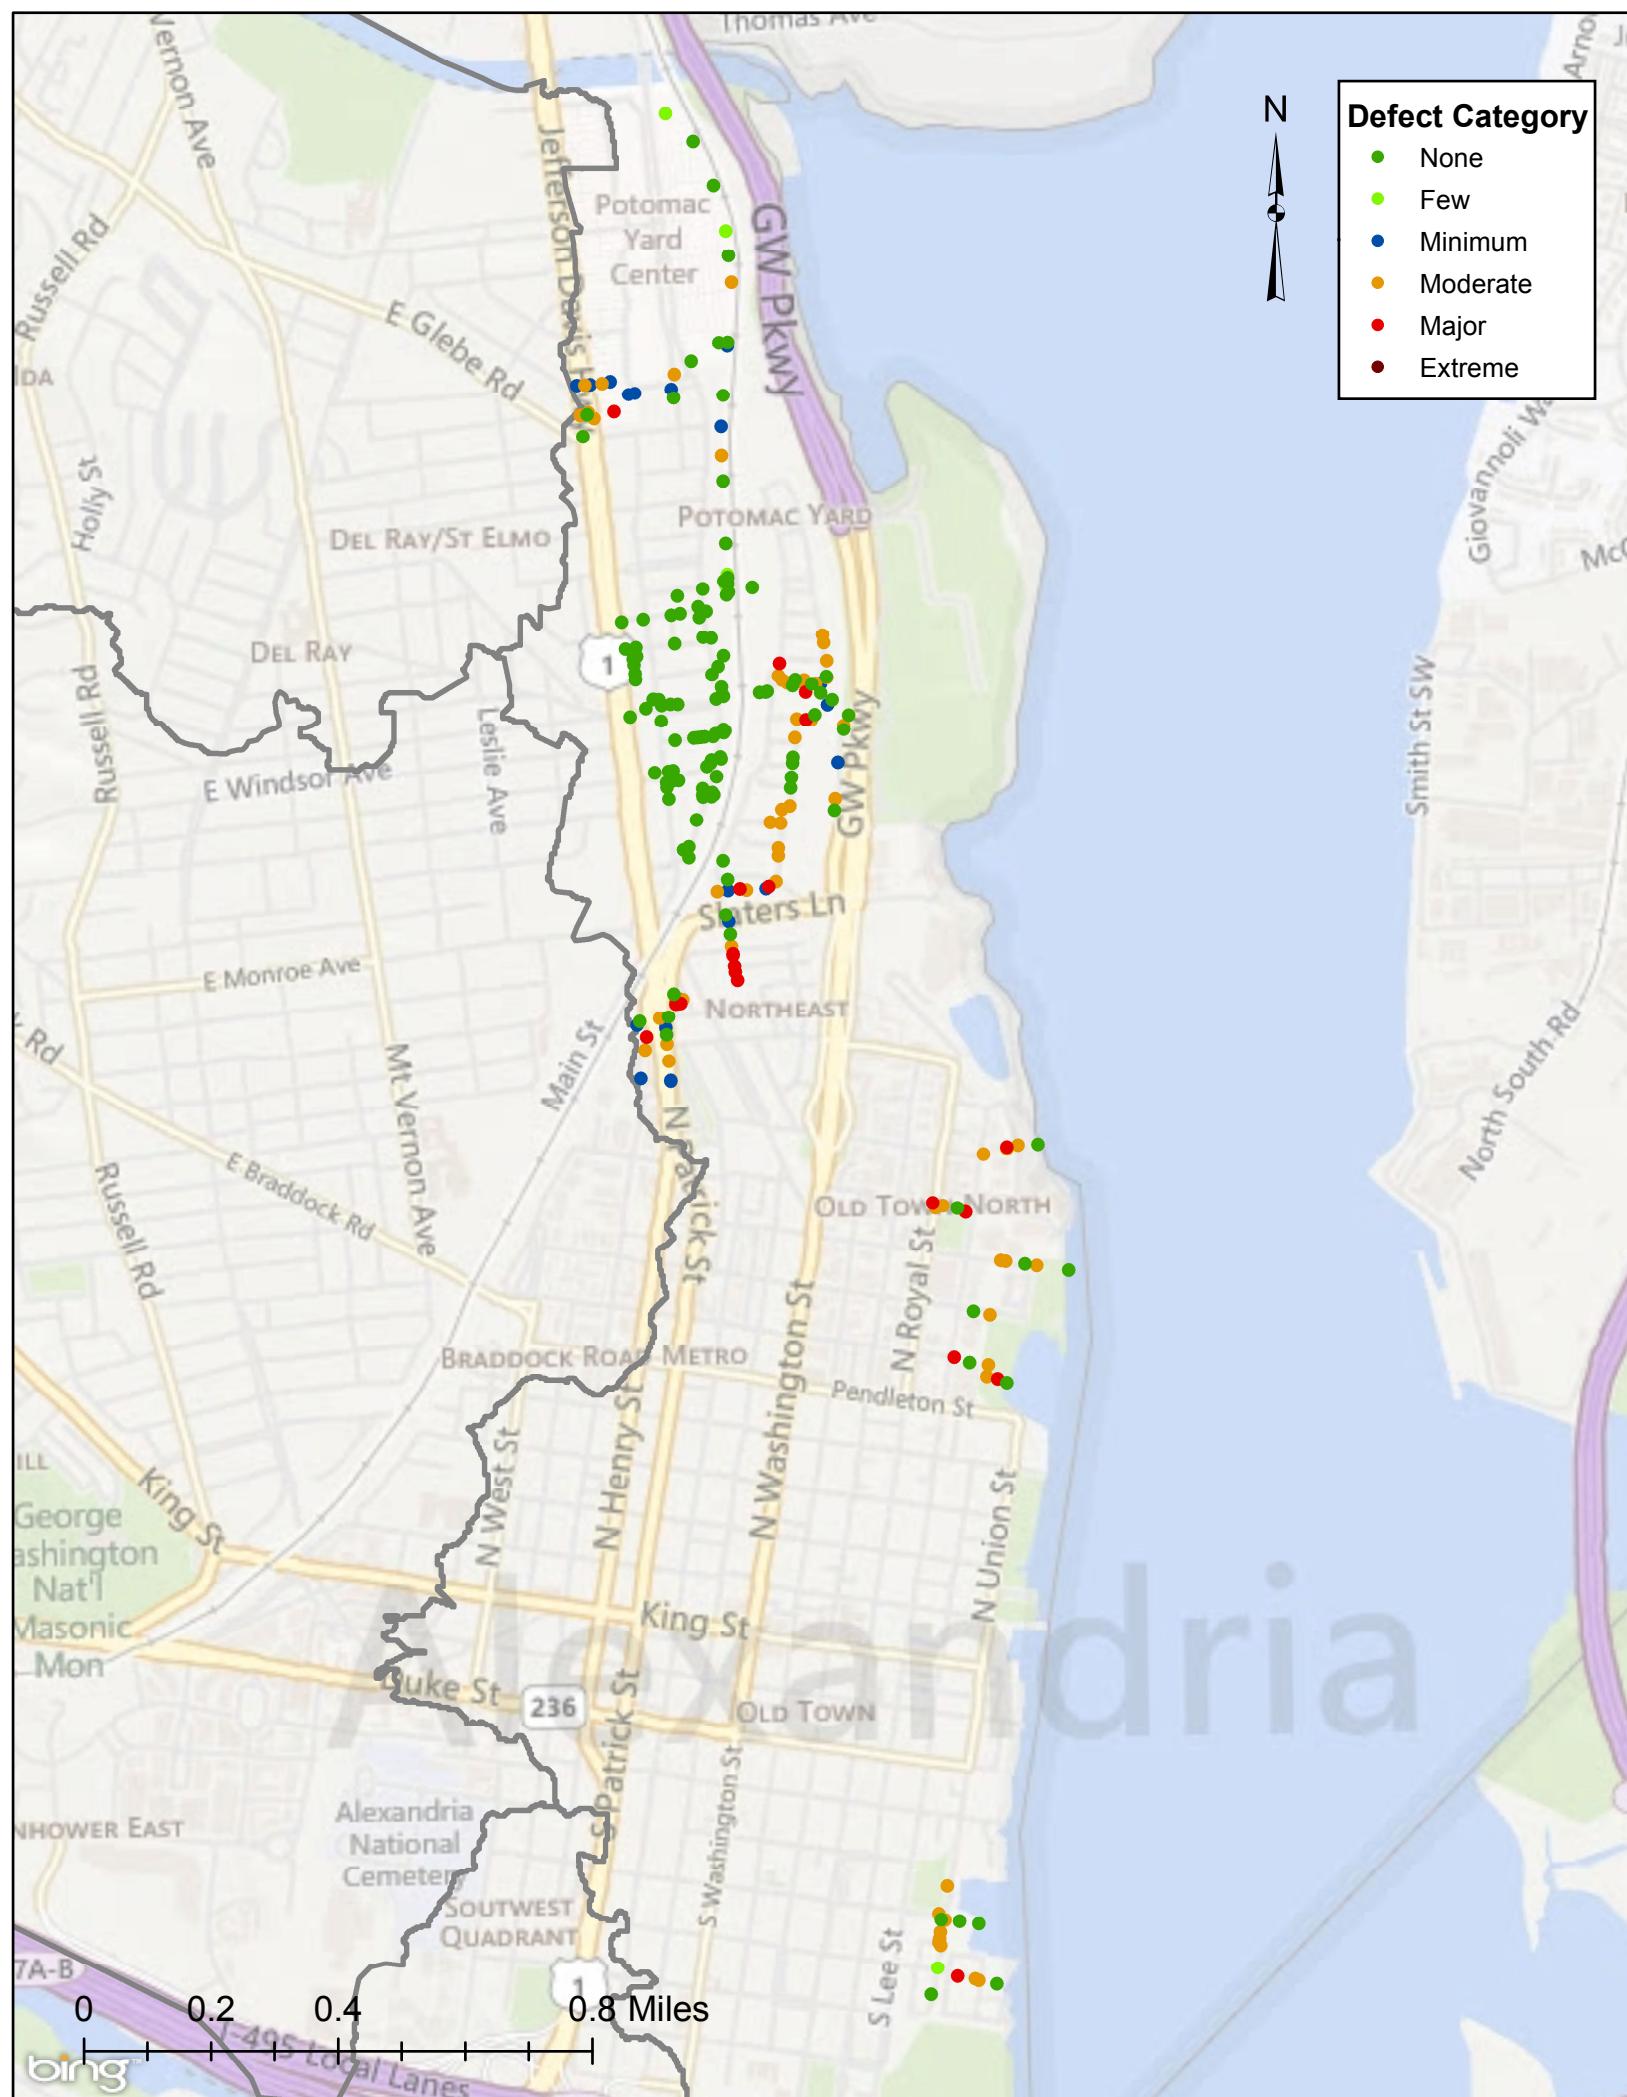


Figure 3 displays the location of the structures classified with major damage only. No extreme defects were observed within Potomac River watershed. In general, the structures with high defect scores are located between Slaters Lane and Pendleton Street, on both sides of George Washington Memorial Parkway. For further detailed condition assessment, the inspection results of the structures were broken down by structure component. Table 2 lists the number of observed defects by component and severity. Note that the table shows a count of the number of defects found in each component and their respective severity across all structures, not the number of inspections performed. Multiple defects may be found in a single component of a structure.

Table 2 - Count of Structure Inspection Observations by MH Component and Severity.

Structure Component	Min	Mod	Maj	Extreme
Cover	-	-	-	-
Frame	3	2	2	1
Frame Base Seal	116	12	2	2
Grade Ring	1	-	-	-
Chimney/Shhaft	131	12	1	-
Chamber	219	18	-	-
Bench	3	5	-	-
Steps	3	-	-	-
Channel	5	2	-	8
Pipe Connection	5	1	-	2

Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).

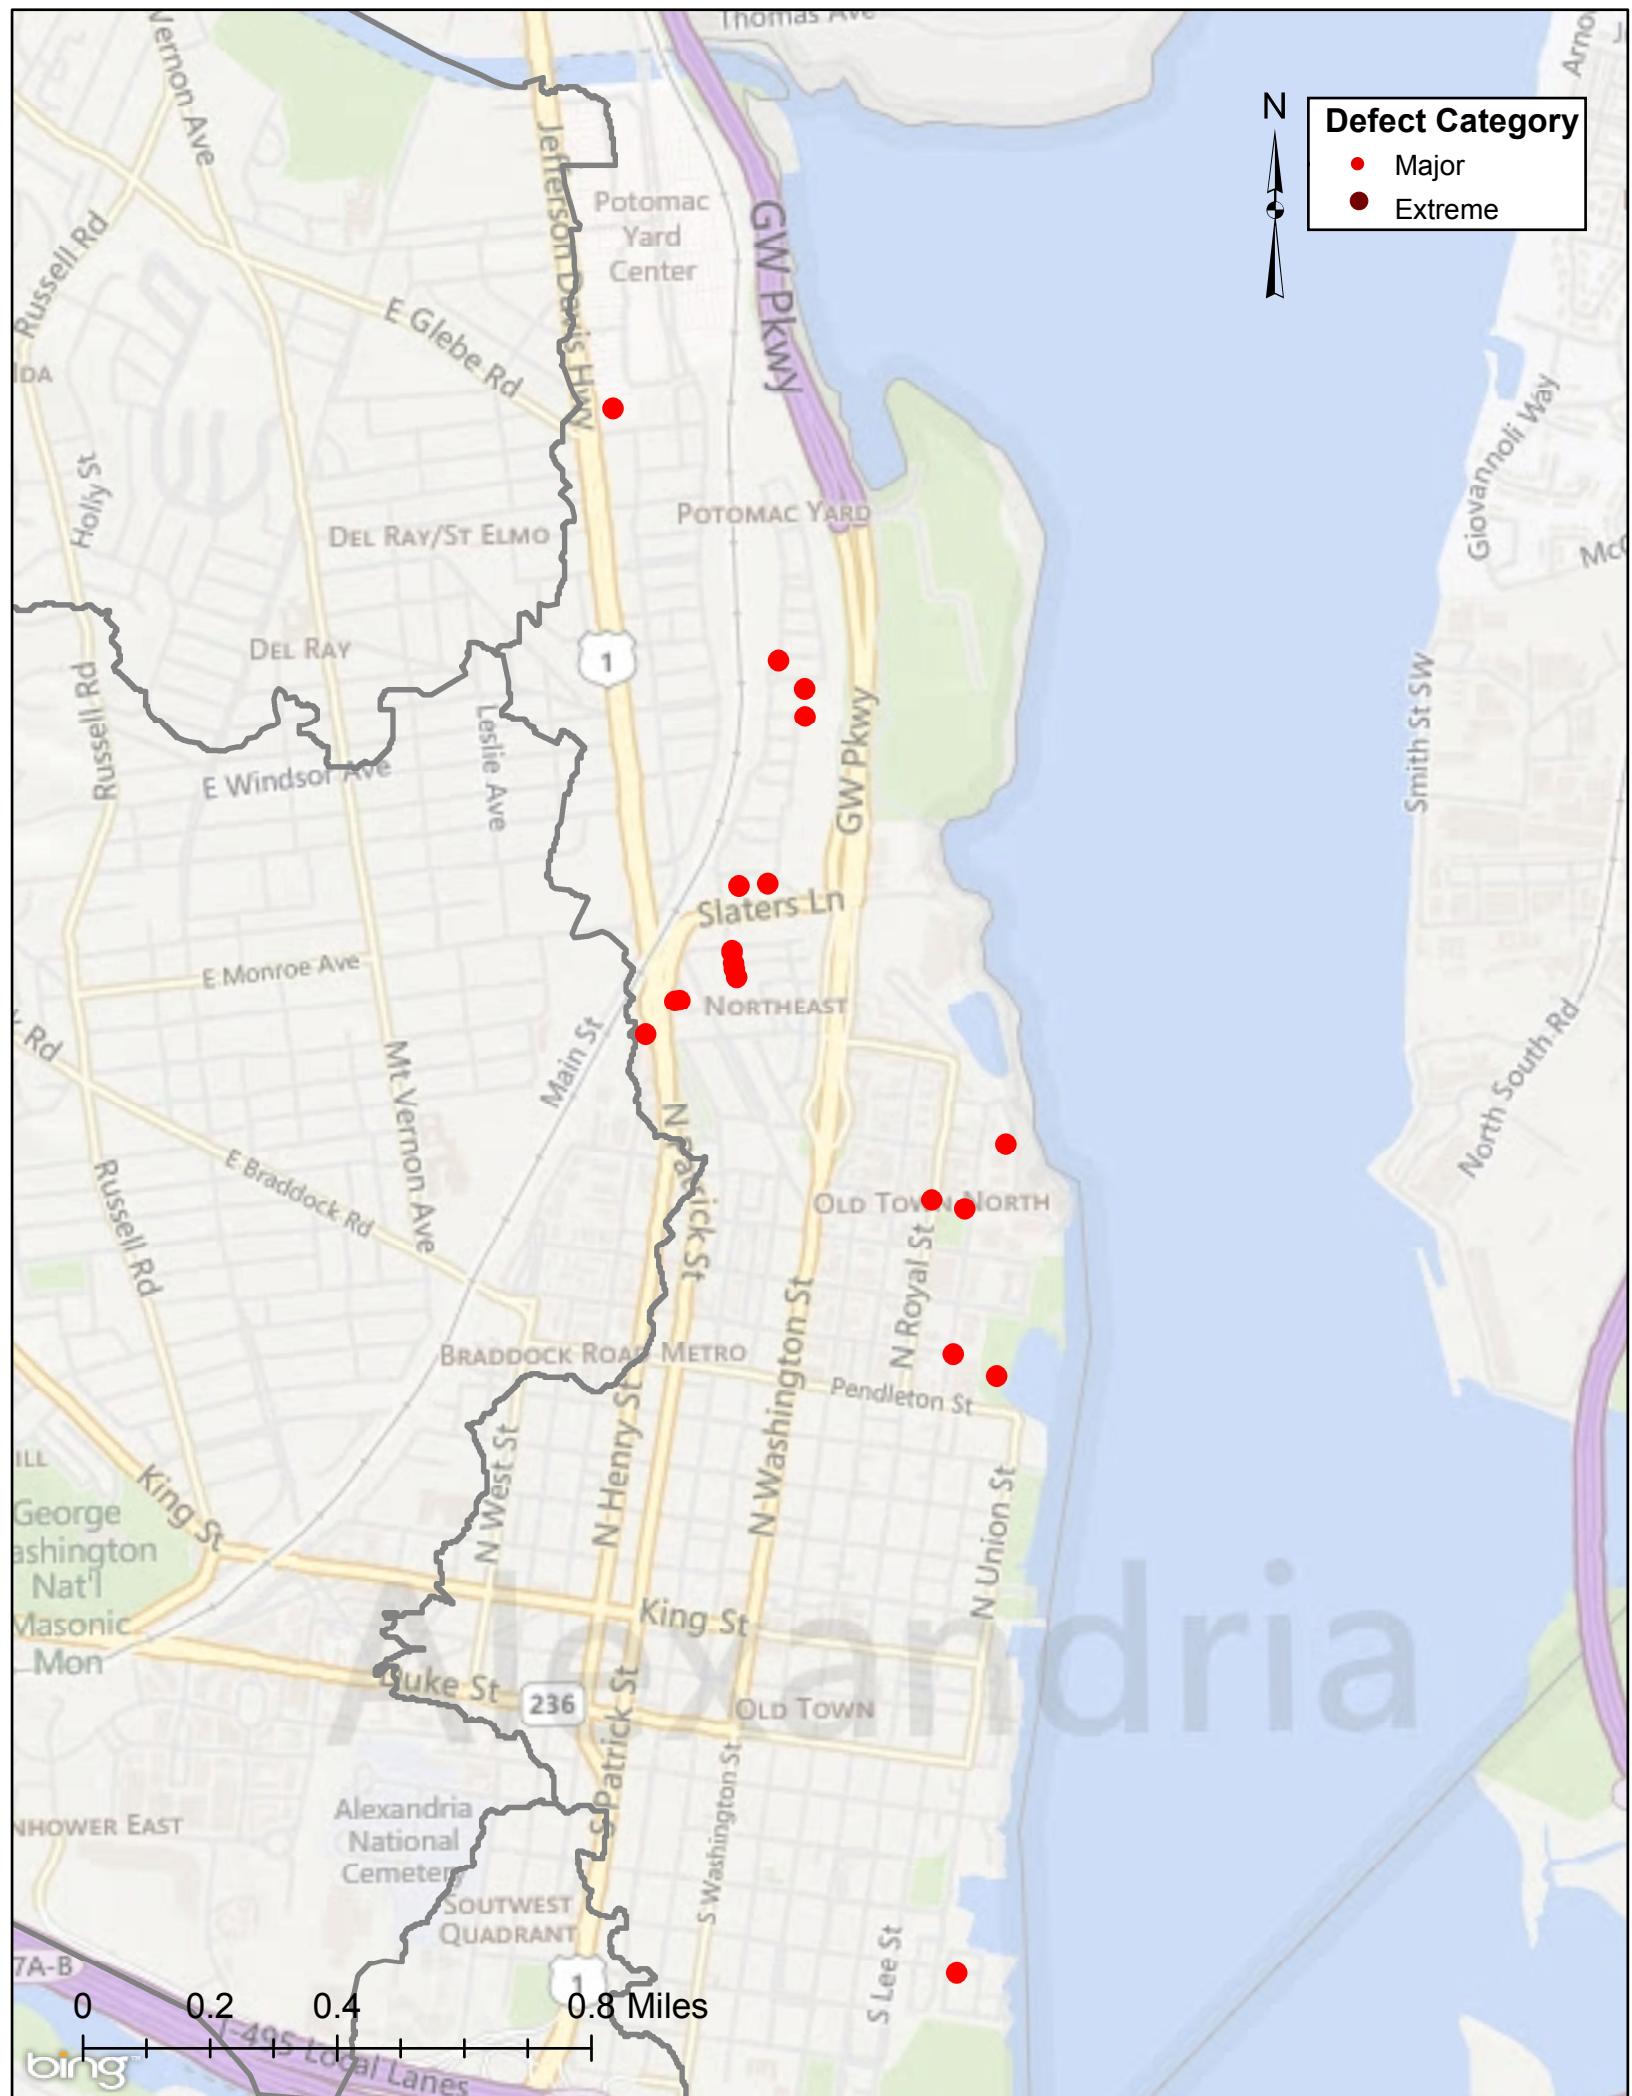


Observed defects of lower severity ("Minimum" and "Moderate" defect categories) were frequently associated with the frame base seal, chimney, and chamber components. Five instances or occurrences of major damage were observed in the Potomac River structures, and 13 extreme damage occurrences were recorded. No defects were observed associated with manhole covers.


A large percentage of the observed structure defects were associated with the chamber, chimney, and frame base seal areas. Combined, there were over 450 instances of low-severity defects and 42 moderate-severity defects in these areas. Cracks are one of the most commonly observed defects in storm structures. A crack $1/16''$ to $1/8''$ in width, for example, is considered moderate damage. Corroded, pitted, or spalled portions of a structure are another type of observed damage; for example, 10-25% of material loss classifies the damage as moderate. Figures 4, 5, and 6 are examples of moderate damage to the chamber, chimney, and frame base seal, respectively.



**Figure 4. Moderate Damage to Chamber Wall in Structure 001925SMH
(Overall SCREAM Score = 65).**

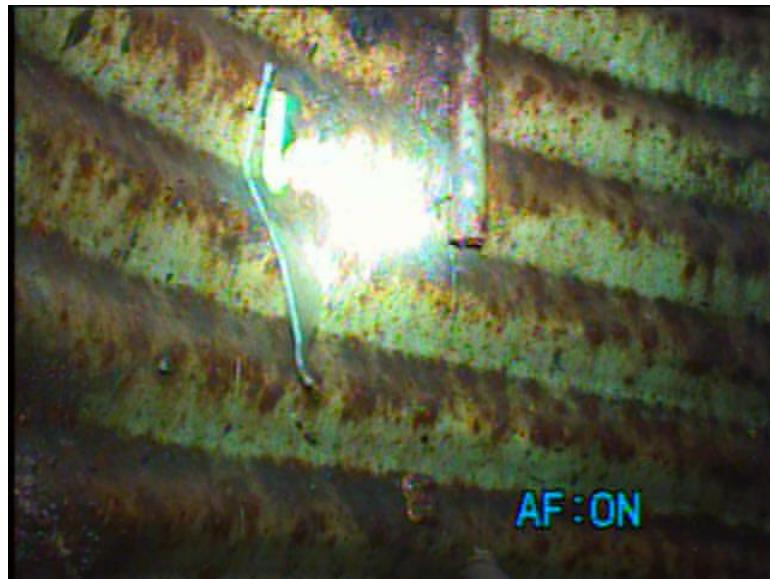

**Figure 5. Damage to Chimney in Structure 002437SMH
(Overall SCREAM Score = 70).**

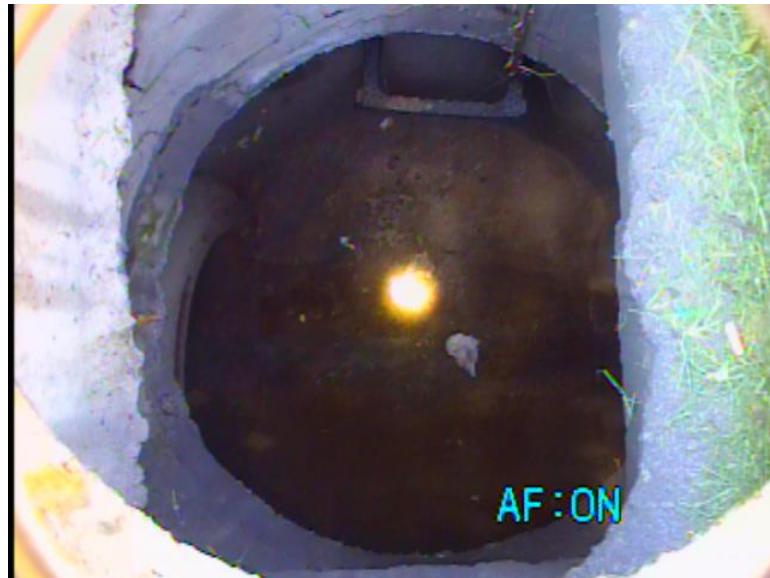

**Figure 6. Moderate Damage to Frame Base Seal in Structure 008168IN
(Overall SCREAM Score = 56).**

Examples of problems in the major category for the frame base seal and frame are shown in Figures 7 and 8, respectively.



**Figure 7. Major Frame Base Seal Damage on Structure 008281IN
(Overall SCREAM Score = 78).**



**Figure 8. Major Frame Damage (Offset) on Structure 001902SMH
(Overall SCREAM Score = 73).**

The problems in the component “Extreme” category were associated with the frame, frame base seal, channel, and pipe connections. Generally, this involved large amounts of settled debris (more than about five gallons), large cracks in the concrete (larger than $\frac{1}{4}$ inch), or spalling and etching (25% to 50%

material loss). Infiltration associated with the cracks (inflow higher than about 10 gpm) is also ranked in the extreme category of defects. Figures 9, 10, and 11 are examples of problems in the extreme category associated with the frame, frame base seal, and channel, respectively.



**Figure 9. Offset Frame in Structure 001892SMH
(Overall SCREAM Score = 75).**



**Figure 10. Extreme Frame Base Seal Damage in Structure 002448SMH
(Overall SCREAM Score = 76).**



**Figure 11. Heavy Debris in Structure 002445SMH
(Overall SCREAM Score = 72).**

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

Pipeline Inspections

In total, 345 storm sewer pipe segments were inspected in the Potomac River watershed. Figure 12 shows the number of pipe segments within each defect category. Figure 13 shows a map of the location of each inspected pipeline, color coded by the defect categories described above. In total, eight (8) defects were observed in the inspected Potomac River watershed pipes. The average condition score was fewer than 1 ("Few" defect category). Inspection results showed that the pipe segments were observed to be in generally good condition, with no defect observed in 98% of the pipes.



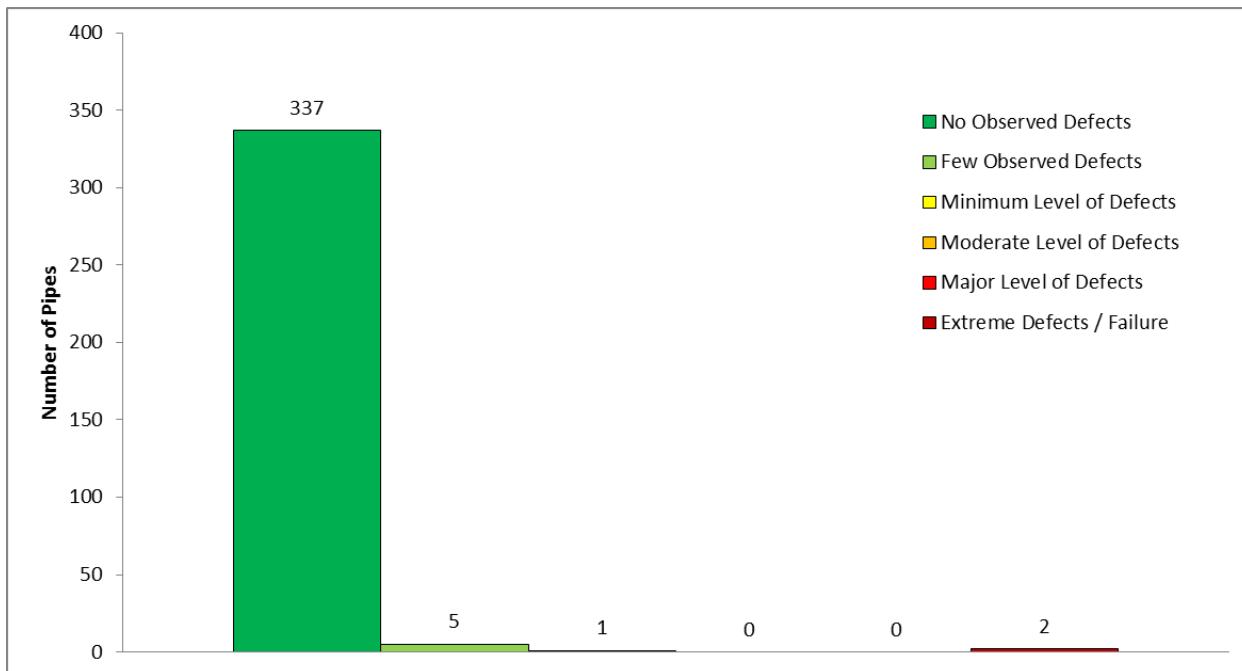


Figure 12. Pipe Lamping Inspections Summary.

Figure 13. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).

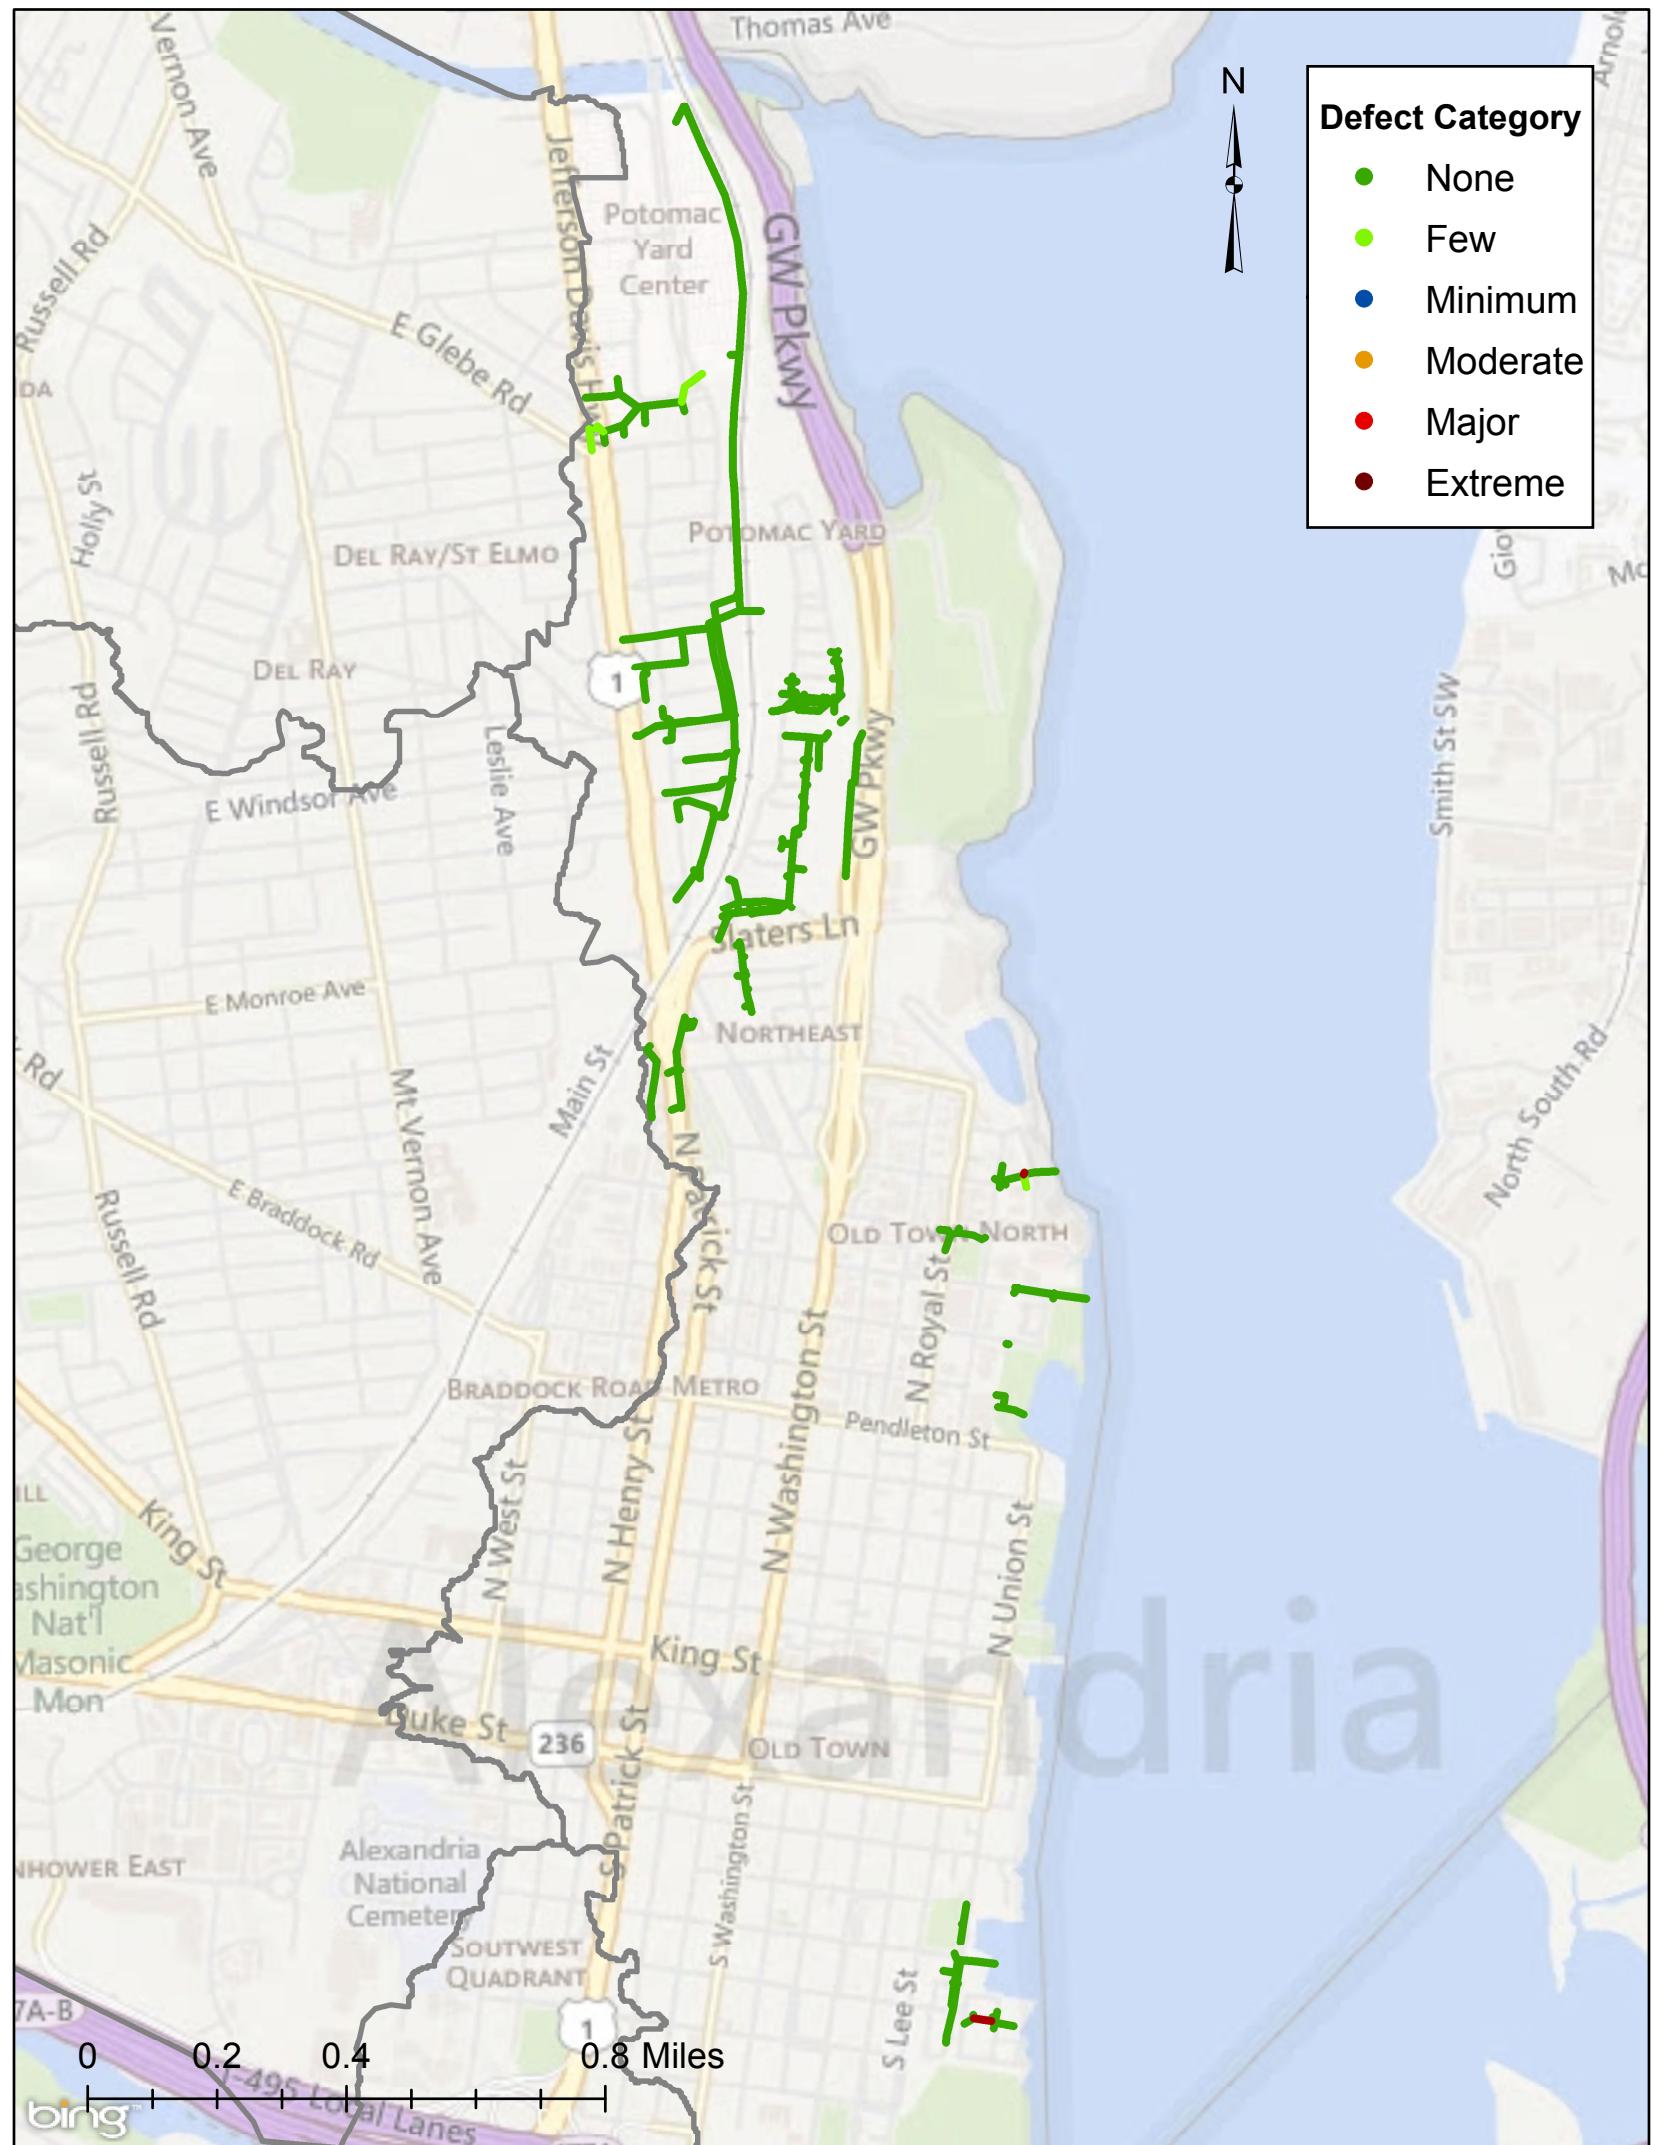

The observed defects in the Potomac River watershed storm pipe segments were related to infiltration (4 instances), root intrusion (4 instances), displaced pipes (1 instance), and collapse (1 instance). The following figures are examples of observed defects in the Potomac River watershed. Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.

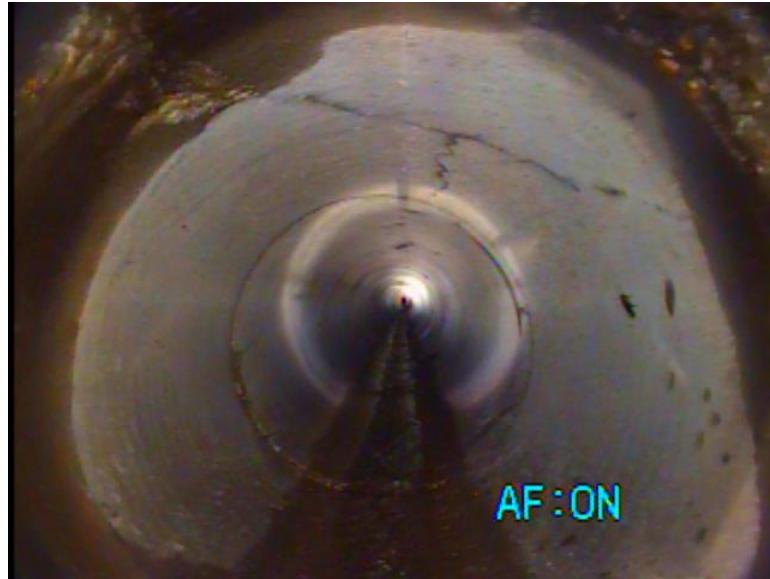

**Figure 14. Infiltration Evidence in 36-in Storm Pipe between Structures 008167IN and 008162IN
(Overall SCREAM Score = 13).**



**Figure 15. Displaced 15-in Storm Pipe between Structures 005138IN and 002379SMH
(Overall SCREAM Score = 25).**



**Figure 16. Collapsed 15-in Storm Pipe between Structures 005137IN and 002379SMH
(Overall SCREAM Score = 100).**

Summary

In total, 178 storm sewer structures and 345 associated pipeline segments were visually inspected for defects and damage using the lamping technique. The average SCREAM condition score for the storm structures was 29 (Minimum) and the average condition score for the pipe segments was fewer than 1 (Few). Two (2) pipe segments and zero (0) manholes inspected had observed defects in the extreme category (scores 81-100). There were no pipe segments with overall SCREAM scores in the moderate or major score categories.

Appendix A – Structure Inspection Summary

(Sorted by Defect Score)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

Alexandria - Potomac River

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	008281IN	X	708	CARPENTER RD	Alley	07/12/2013	Truck 1	Complete Inspection	78	78	0		4
Potomac	002448SMH	X	916	BERNARD ST	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	76	76	15		5
Potomac	001892SMH	X	1551	POTOMAC GREENS DR	Easement	08/01/2013	Truck 1	Complete Inspection	75	75	0		2
Potomac	001902SMH	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	Truck 1	Complete Inspection	73	74	0		4
Potomac	002444SMH	X	917	PORTNER PL	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	73	54	50		3
Potomac	002445SMH	X	916	PORTNER PL	Sidewalk	08/01/2013	Truck 1	Complete Inspection	72	50	50		2
Potomac	002436SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	Truck 1	Complete Inspection	71	53	50		2
Potomac	002435SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	Truck 1	Complete Inspection	70	52	50		3
Potomac	002437SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	Truck 1	Complete Inspection	70	52	50		2
Potomac	003056SMH	X	1200	N FAYETTE ST	Parking Lot	08/23/2013	Truck 1	Complete Inspection	70	46	50		2
Potomac	002346SMH	X	601	N FAIRFAX ST	Sidewalk	08/09/2013	Truck 1	Complete Inspection	68	67	5		3
Potomac	002379SMH	X	1111	N FAIRFAX ST	Yard-Back	08/09/2013	Truck 1	Complete Inspection	68	69	0		4
Potomac	002471SMH	X	100	MADISON ST	Yard-Back	08/09/2013	Truck 1	Complete Inspection	68	69	0		2
Potomac	007189IN	X	916	BERNARD ST	Sidewalk	08/01/2013	Truck 1	Complete Inspection	68	42	50		2
Potomac	002447SMH	X	1401	PORTNER RD	Sidewalk	08/01/2013	Truck 1	Complete Inspection	67	39	50		4
Potomac	001925SMH	X	1718	POTOMAC GREENS DR	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	65	66	0		4
Potomac	001885SMH	X	1695	HUNTING CREEK DR	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	64	65	0		3
Potomac	008160IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	63	63	0		3
Potomac	002386SMH	X	901	N ROYAL ST	Easement	08/09/2013	Truck 1	Complete Inspection	61	62	0		2
Potomac	004862SMH	X	1099	PITT ST	Sidewalk	08/09/2013	Truck 1	Complete Inspection	61	62	0		3
Potomac	005353IN	X	99	FRANKLIN ST	Curb/Gutter	08/23/2013	Truck 1	Complete Inspection	61	42	40		3
Potomac	001886SMH	X	710	NORFOLK LA	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	59	60	0		4
Potomac	001895SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	59	60	0		4
Potomac	001926SMH	X	1706	POTOMAC GREENS DR	Easement	07/12/2013	Truck 1	Complete Inspection	57	58	0		4
Potomac	001889SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	56	57	0		3
Potomac	001890SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	56	57	0		3
Potomac	001894SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	56	57	0		2
Potomac	002977SMH	X	100	GIBBON ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	56	56	0		3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	004111SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	56	57	0		4
Potomac	008168IN	X	3104	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	Truck 1	Complete Inspection	56	57	0		2
Potomac	008207IN	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	Truck 1	Complete Inspection	56	57	0		4
Potomac	002979SMH	X	100	GIBBON ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	54	55	0		3
Potomac	003006SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	54	55	0		4
Potomac	007195IN	X	921	BERNARD ST	Sidewalk	08/01/2013	Truck 1	Complete Inspection	54	55	0		3
Potomac	002350SMH	X	990	N LEE ST	Light Highway Rural Streets	08/09/2013	Truck 1	Complete Inspection	53	54	0		4
Potomac	002976SMH	X	600	S UNION ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	53	53	5		3
Potomac	002493SMH	X	100	MADISON ST	Yard-Back	08/09/2013	Truck 1	Complete Inspection	52	53	0		2
Potomac	005355IN	X	99	FRANKLIN ST	Curb/Gutter	08/23/2013	Truck 1	Complete Inspection	52	53	0		4
Potomac	007816IN	X	1010	BASHFORD LA	Sidewalk	08/23/2013	Truck 1	Complete Inspection	52	53	0		2
Potomac	001860SMH	X	3104	JEFFERSON DAVIS HY	Parking Lot	08/01/2013	Truck 1	Complete Inspection	51	52	0		2
Potomac	001893SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	51	52	0		4
Potomac	001921SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	51	52	0		4
Potomac	002352SMH	X	66	CANAL CENTER PZ	Light Highway Rural Streets	08/09/2013	Truck 1	Complete Inspection	51	52	0		4
Potomac	002694SMH	X	727	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	51	52	0		2
Potomac	002987SMH	X	101	POMMANDER WALK ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	51	52	0		4
Potomac	004112SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	51	52	0		4
Potomac	004115SMH	X	901	ROYAL ST	Light Highway Rural Streets	08/09/2013	Truck 1	Complete Inspection	51	52	0		3
Potomac	001880SMH	X	1800	W ABINGDON DR	Easement	07/18/2013	Truck 1	Complete Inspection	50	51	0		2
Potomac	001896SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	50	51	0		3
Potomac	001900SMH	X	1550	POTOMAC GREENS DR	Parking Lot	08/01/2013	Truck 1	Complete Inspection	50	51	0		4
Potomac	003055SMH	X	1011	BASHFORD LA	Sidewalk	08/23/2013	Truck 1	Complete Inspection	50	51	0		4
Potomac	004861SMH	X	1400	ARGALL PL	Sidewalk	08/23/2013	Truck 1	Complete Inspection	50	51	0		0
Potomac	005155IN	X	701	N FAIRFAX ST	Sidewalk	08/09/2013	Truck 1	Complete Inspection	50	50	0		1
Potomac	008133IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	50	51	0		2
Potomac	008283IN	X	716	CARPENTER RD	Sidewalk	07/12/2013	Truck 1	Complete Inspection	50	51	0		3
Potomac	002385SMH	X	901	N ROYAL ST	Easement	08/09/2013	Truck 1	Complete Inspection	49	47	5		2
Potomac	008170IN	X	3006	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	Truck 1	Complete Inspection	49	50	0		2
Potomac	009824IN	X	1099	N PITT ST	Sidewalk	08/09/2013	Truck 1	Complete Inspection	49	50	0		3
Potomac	001922SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	48	49	0		3
Potomac	001927SMH	X	728	CARPENTER RD	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	48	49	0		5

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	001928SMH	X	1706	POTOMAC GREENS DR	Light Highway Rural Streets	07/12/2013	Truck 1	Complete Inspection	48	49	0		3
Potomac	005328IN	X	101	POMMANDER WALK ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	48	49	0		2
Potomac	008282IN	X	700	CARPENTER RD	Sidewalk	07/12/2013	Truck 1	Complete Inspection	48	49	0		5
Potomac	002351SMH	X	66	CANAL CENTER PZ	Light Highway Rural Streets	08/09/2013	Truck 1	Complete Inspection	47	48	0		3
Potomac	002441SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	Truck 1	Complete Inspection	47	47	0		2
Potomac	008162IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	47	48	0		3
Potomac	001891SMH	X	710	NORFOLK LA	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	46	46	0		4
Potomac	002983SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	46	47	0		2
Potomac	007825IN	X	1200	N FAYETTE ST	Parking Lot	08/23/2013	Truck 1	Complete Inspection	46	38	19		2
Potomac	008167IN	X	3006	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	Truck 1	Complete Inspection	46	47	0		2
Potomac	006502IN	X	1800	W ABINGDON DR	Sidewalk	07/12/2013	Truck 1	Complete Inspection	45	46	0		2
Potomac	005146IN	X	1199	N FAIRFAX ST	Sidewalk	08/09/2013	Truck 1	Complete Inspection	44	45	0		5
Potomac	001887SMH	X	710	NORFOLK LA	Light Highway Rural Streets	08/01/2013	Truck 1	Complete Inspection	42	43	0		3
Potomac	002380SMH	X	1111	N FAIRFAX ST	Yard-Back	08/09/2013	Truck 1	Complete Inspection	42	43	0		3
Potomac	005326IN	X	520	S LEE ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	42	42	0		1
Potomac	006485IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	Truck 1	Complete Inspection	42	38	5		2
Potomac	007252IN	X	100	MADISON ST	Yard-Back	08/09/2013	Truck 1	Complete Inspection	42	42	0		3
Potomac	008137IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	42	43	0		3
Potomac	008156IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	42	42	0		2
Potomac	002432SMH	X	1400	ARGALL PL	Easement	08/01/2013	Truck 1	Complete Inspection	41	41	0		3
Potomac	002985SMH	X	501	S UNION ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	41	41	0		3
Potomac	005141IN	X	1	CANAL CENTER PZ	Easement	08/09/2013	Truck 1	Complete Inspection	41	41	0		2
Potomac	006486IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	Truck 1	Complete Inspection	37	38	0		2
Potomac	007203IN	X	828	SLATERS LA	Sidewalk	08/01/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	007813IN	X	1400	ARGALL PL	Sidewalk	08/23/2013	Truck 1	Complete Inspection	37	38	0		5
Potomac	007817IN	X	1009	DOUGLAS ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	37	38	0		2
Potomac	007818IN	X	1009	DOUGLAS ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	007824IN	X	1200	N FAYETTE ST	Parking Lot	08/23/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	008058IN	X	3104	JEFFERSON DAVIS HY	Parking Lot	07/18/2013	Truck 1	Complete Inspection	37	38	0		2
Potomac	008059IN	X	3104	JEFFERSON DAVIS HY	Parking Lot	07/18/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	008155IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	008157IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	37	38	0		3
Potomac	008169IN	X	3104	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	Truck 1	Complete Inspection	35	35	0		1
Potomac	002433SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	Truck 1	Complete Inspection	31	31	0		3
Potomac	000020CD	X	704	CARPENTER RD	Easement	07/12/2013	Truck 1	Complete Inspection	28	29	0		1
Potomac	007821IN	X	1200	N FAYETTE ST	Parking Lot	08/23/2013	Truck 1	Complete Inspection	28	29	0		2
Potomac	001901SMH	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	Truck 1	Complete Inspection	27	28	0		3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	006510IN	X	815	SLATERS LA	Easement	08/01/2013	Truck 1	Complete Inspection	26	26	0		2
Potomac	008134IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	26	26	0		2
Potomac	008136IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	26	26	0		2
Potomac	008159IN	X	2801	MAIN ST	Parking Lot	07/18/2013	Truck 1	Complete Inspection	26	26	0		3
Potomac	008286IN	X	700	CARPENTER RD	Sidewalk	07/12/2013	Truck 1	Complete Inspection	26	26	0		4
Potomac	000016CD	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	20	0	20		2
Potomac	001842SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	Truck 1	Complete Inspection	15	15	0		2
Potomac	008132IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	15	15	0		2
Potomac	001843SMH	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	5	0	5		3
Potomac	002984SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	Truck 1	Complete Inspection	5	5	0		2
Potomac	000017CD	X	2401	JEFFERSON DAVIS HY		08/15/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	0001052ND	X	2401	POTOMAC AV		08/15/2013	Truck 1	Not Inspected - No Access	0	0	0		3
Potomac	0001055ND	X	2405	POTOMAC AV		08/15/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	0001062ND	X	701	N FAIRFAX ST		08/09/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	0001093ND	X	100	GIBBON ST		08/23/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	000369IO	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000370IO	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000404IO	X	700	CARPENTER RD	Easement	08/01/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000405IO	X	700	CARPENTER RD	Easement	07/12/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000406IO	X	704	CARPENTER RD	Easement	07/12/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000407IO	X	1644	HUNTING CREEK DR	Easement	07/12/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000409IO	X	1702	POTOMAC GREENS DR	Easement	08/01/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000411IO	X	2401	POTOMAC AV		08/15/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	000412IO	X	1702	POTOMAC GREENS DR	Easement	08/01/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000469IO	X	1	CANAL CENTER PZ		08/09/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	000471IO	X	1	CANAL CENTER PZ	Easement	08/09/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	000481IO	X	100	MADISON ST	Easement	08/09/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000491IO	X	99	FRANKLIN ST		08/23/2013	Truck 1	Not Inspected - Not found	0	0	0		1
Potomac	000495IO	X	600	S UNION ST	Easement	08/23/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000545IO	X	1401	POTOMAC AV	Easement	08/23/2013	Truck 1	Complete Inspection	0	0	0		1
Potomac	000872ND	X	1011	BASHFORD LA		08/23/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	000877ND	X	1400	ARGALL PL		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	001018ND	X	601	N FAIRFAX ST		08/09/2013	Truck 1	Not Inspected - No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	001019ND	X	66	CANAL CENTER PZ		08/09/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	001104ND	X	1644	HUNTING CREEK DR		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		1
Potomac	001107ND	X	1644	HUNTING CREEK DR		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		1
Potomac	001108ND	X	1644	HUNTING CREEK DR		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		1
Potomac	001109ND	X	1644	HUNTING CREEK DR		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		1
Potomac	001119ND	X	700	CARPENTER RD		07/12/2013	Truck 1	Not Inspected - Not found	0	0	0		1
Potomac	001120ND	X	700	CARPENTER RD		07/12/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	001123ND	X	1702	POTOMAC GREENS DR		08/01/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	001124ND	X	723	CARPENTER RD		07/12/2013	Truck 1	Not Inspected - Not found	0	0	0		1
Potomac	001125ND	X	708	CARPENTER RD		07/12/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	001841SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	001859SMH	X	3006	JEFFERSON DAVIS HY		11/18/2014	Truck 1	Complete Inspection	0	0	0		0
Potomac	001864SMH	X	3000	JEFFERSON DAVIS HY		11/18/2014	Truck 1	Complete Inspection	0	0	0		0
Potomac	002074ND	X	2801	MAIN LINE BV		07/18/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	002078ND	X	901	ROYAL ST		08/09/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	002079ND	X	#N/A	#N/A		08/15/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	002080ND	X	3601	POTOMAC AV		08/15/2013	Truck 1	Not Inspected - No Access	0	0	0		0
Potomac	002450SMH	X	921	BERNARD ST	Sidewalk	08/01/2013	Truck 1	Complete Inspection	0	0	0		3
Potomac	002455SMH	X	1400	ARGALL PL		11/18/2014	Truck 1	Complete Inspection	0	0	0		0
Potomac	004122SMH	X	600	UNION ST		11/18/2014	Truck 1	Complete Inspection	0	0	0		0
Potomac	004800SMH	X	2400	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		1
Potomac	004801SMH	X	2400	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		3
Potomac	004802SMH	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004803SMH	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004804SMH	X	2400	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004805SMH	X	2400	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004806SMH	X	2000	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004807SMH	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004808SMH	X	700	CUSTIS AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		3
Potomac	004809SMH	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004810SMH	X	734	DIAMOND AV		11/03/2014	Truck 1	Complete Inspection	0	0	0		1
Potomac	004811SMH	X	722	DIAMOND AV		11/03/2014	Truck 1	Complete Inspection	0	0	0		2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	004812SMH	X	734	DIAMOND AV		11/03/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004813SMH	X	734	HOWELL AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004814SMH	X	700	HOWELL AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004815SMH	X	700	HOWELL AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004816SMH	X	1801	MAIN LINE BV		11/18/2014	Truck 1	Complete Inspection	0	0	0		0
Potomac	004817SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004818SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004819SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004820SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004821SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004822SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		3
Potomac	004823SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004824SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	004825SMH	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		3
Potomac	004826SMH	X	2000	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		1
Potomac	004829SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		3
Potomac	004830SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		3
Potomac	004831SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004832SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004833SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004834SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		3
Potomac	004835SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004836SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004837SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004838SMH	X	2501	MAIN LINE BV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004839SMH	X	2424	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004840SMH	X	2424	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004841SMH	X	2224	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004842SMH	X	2200	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004843SMH	X	712	CUSTIS AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004844SMH	X	700	CUSTIS AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004846SMH	X	734	HOWELL AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004848SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		3
Potomac	004849SMH	X	2401	POTOMAC AV		10/30/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004850SMH	X	2501	MAIN LINE BV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004851SMH	X	2401	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004852SMH	X	717	MCKENZIE AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004853SMH	X	2501	MAIN LINE BV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		3
Potomac	004854SMH	X	726	DIAMOND AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (apm)	# Connecting Pipes
Potomac	004855SMH	X	728	DIAMOND AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004856SMH	X	2024	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004857SMH	X	2100	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004858SMH	X	2401	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	004859SMH	X	1551	POTOMAC GREENS DR		08/01/2013	Truck 1	Not Inspected - Not found	0	0	0		0
Potomac	005351IN	X	719	S UNION ST	Sidewalk	08/23/2013	Truck 1	Complete Inspection	0	0	0		4
Potomac	006484IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	006488IN	X	1800	W ABINGDON DR	Sidewalk	07/18/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	008130IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		3
Potomac	008131IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		3
Potomac	008135IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	008138IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	008139IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		4
Potomac	008199IN	X	710	NORFOLK LA	Sidewalk	08/01/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	008201IN	X	1551	POTOMAC GREENS DR	Sidewalk	08/01/2013	Truck 1	Complete Inspection	0	0	0		3
Potomac	009249IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	009250IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		3
Potomac	009252IN	X	2401	POTOMAC AV	Easement	08/15/2013	Truck 1	Complete Inspection	0	0	0		2
Potomac	009800IN	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009801IN	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009802IN	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009804IN	X	2203	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009805IN	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009807IN	X	2113	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009809IN	X	734	HOWELL AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009810IN	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009811IN	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009812IN	X	2401	POTOMAC AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009813IN	X	2401	POTOMAC AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009814IN	X	1801	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		1
Potomac	009815IN	X	2200	MAIN LINE BV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009817IN	X	734	HOWELL AV		10/30/2014	Truck 1	Complete Inspection	0	0	0		2
Potomac	009820IN	X	2401	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2
Potomac	009821IN	X	2401	POTOMAC AV		11/03/2014	Truck 1	Not Inspected - Other	0	0	0		2

Appendix B – Structure Inspection Report
(Includes Defect Detail)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

Alexandria - Potomac River

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	000016CD	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		20	0	20	0	2
				Bench	Roots Intrusion	Mod: 1/16" to 1/8" (2-3mm) dia. fingers, ~3/8" (1cm) dia. runner		Maintenance							
Potomac	000017CD	X	2401	JEFFERSON DAVIS HY		08/15/2013	08/15/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	000020CD	X	704	CARPENTER RD	Easement	07/12/2013	07/12/2013	Truck 1	1		28	29	0	0	1
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Potomac	0001052ND	X	2401	POTOMAC AV		08/15/2013	08/15/2013	Truck 1	1	No Access	0	0	0	0	3
Potomac	0001055ND	X	2405	POTOMAC AV		08/15/2013	08/15/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	0001062ND	X	701	N FAIRFAX ST		08/09/2013	08/09/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	0001093ND	X	100	GIBBON ST		08/23/2013	08/23/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	000369IO	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	1
Potomac	000370IO	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	1
Potomac	000404IO	X	700	CARPENTER RD	Easement	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	1
Potomac	000405IO	X	700	CARPENTER RD	Easement	07/12/2013	07/12/2013	Truck 1	1		0	0	0	0	1
Potomac	000406IO	X	704	CARPENTER RD	Easement	07/12/2013	07/12/2013	Truck 1	1		0	0	0	0	1
Potomac	000407IO	X	1644	HUNTING CREEK DR	Easement	07/12/2013	07/12/2013	Truck 1	1		0	0	0	0	1
Potomac	000409IO	X	1702	POTOMAC GREENS DR	Easement	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	1
Potomac	000411IO	X	2401	POTOMAC AV		08/15/2013	08/15/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	000412IO	X	1702	POTOMAC GREENS DR	Easement	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	1
Potomac	000469IO	X	1	CANAL CENTER PZ		08/09/2013	08/09/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	000471IO	X	1	CANAL CENTER PZ	Easement	08/09/2013	08/09/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	000481IO	X	100	MADISON ST	Easement	08/09/2013	08/09/2013	Truck 1	1		0	0	0	0	1
Potomac	000491IO	X	99	FRANKLIN ST		08/23/2013	08/23/2013	Truck 1	1	Not found	0	0	0	0	1
Potomac	000495IO	X	600	S UNION ST	Easement	08/23/2013	08/23/2013	Truck 1	1		0	0	0	0	1
Potomac	000545IO	X	1401	POTOMAC AV	Easement	08/23/2013	08/23/2013	Truck 1	1		0	0	0	0	1
Potomac	000872ND	X	1011	BASHFORD LA		08/23/2013	08/23/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	000877ND	X	1400	ARGALL PL		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	001018ND	X	601	N FAIRFAX ST		08/09/2013	08/09/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	001019ND	X	66	CANAL CENTER PZ		08/09/2013	08/09/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	001104ND	X	1644	HUNTING CREEK DR		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	001107ND	X	1644	HUNTING CREEK DR		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	1
Potomac	001108ND	X	1644	HUNTING CREEK DR		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	1
Potomac	001109ND	X	1644	HUNTING CREEK DR		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	1
Potomac	001119ND	X	700	CARPENTER RD		07/12/2013	07/12/2013	Truck 1	1	Not found	0	0	0	0	1
Potomac	001120ND	X	700	CARPENTER RD		07/12/2013	07/12/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	001123ND	X	1702	POTOMAC GREENS DR		08/01/2013	08/01/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	001124ND	X	708	CARPENTER RD		07/12/2013	07/12/2013	Truck 1	1	Not found	0	0	0	0	1
Potomac	001125ND	X	708	CARPENTER RD		07/12/2013	07/12/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	001841SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	2
Potomac	001842SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	08/15/2013	Truck 1	1		15	15	0	0	2
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
Potomac	001843SMH	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		5	0	5	0	3
				Bench	Debris/deposition	Mod: 1-3gal bucket			Maintenance						
Potomac	001859SMH	X	3006	JEFFERSON DAVIS HY		11/18/2014	11/18/2014	Truck 1	1		0	0	0	0	0
Potomac	001860SMH	X	3104	JEFFERSON DAVIS HY	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		51	52	0	0	2
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Potomac	001864SMH	X	3000	JEFFERSON DAVIS HY		11/18/2014	11/18/2014	Truck 1	1		0	0	0	0	0
Potomac	001880SMH	X	1800	W ABINGDON DR	Easement	07/18/2013	07/18/2013	Truck 1	1		50	51	0	0	2
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Potomac	001885SMH	X	1695	HUNTING CREEK DR	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		64	65	0	0	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	001886SMH	X	710	NORFOLK LA	Chimney/Shelf	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	001887SMH	X	710	NORFOLK LA	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		59	60	0	0	4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
Potomac	001889SMH	X	701	SCARBURGH	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		42	43	0	0	3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	001890SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		56	57	0	0	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	001891SMH	X	710	NORFOLK LA	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural		46	46	0	0	4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	001892SMH	X	1551	POTOMAC GREENS DR	Easement	08/01/2013	08/01/2013	Truck 1	1		75	75	0	0	2
Potomac	001893SMH	X	1644	HUNTING CREEK DR	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural		51	52	0	0	4
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame	Offset	Extreme: > 4" (10cm)		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	001894SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		56	57	0	0	2
Potomac	001894SMH	X	1644	HUNTING CREEK DR	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	001895SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		59	60	0	0	4
					Chamber	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chamber	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chamber	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
					Chimney/Shelf	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chimney/Shelf	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chimney/Shelf	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
					Frame Base Seal	Cracked / deteriorated				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Frame Base Seal	Corroded, pitted, spalled				Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural				
					Frame Base Seal	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Potomac	001896SMH	X	1644	HUNTING CREEK DR	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		50	51	0	0	3
					Chimney/Shelf	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chimney/Shelf	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chimney/Shelf	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
					Chamber	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chamber	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chamber	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Potomac	001900SMH	X	1550	POTOMAC GREENS DR	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		50	51	0	0	4
					Chimney/Shelf	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chimney/Shelf	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chimney/Shelf	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
					Chamber	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chamber	Corroded, pitted, spalled				Min: <10% mat'l loss, etching	Structural				
					Chamber	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Potomac	001901SMH	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		27	28	0	0	3
					Frame Base Seal	Cracked / deteriorated				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Frame Base Seal	Corroded, pitted, spalled				Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural				
Potomac	001902SMH	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		73	74	0	0	4
					Frame	Offset				Maj: 3" to 4" (7.5-10cm)	Structural				
					Chamber	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chamber	Corroded, pitted, spalled				Mod:10-25% mat'l loss, etching	Structural				
					Chamber	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
					Chimney/Shelf	Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
					Chimney/Shelf	Corroded, pitted, spalled				Mod:10-25% mat'l loss, etching	Structural				
					Chimney/Shelf	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	001921SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		51	52	0	0	4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Potomac	001922SMH	X	700	CARPENTER RD	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		48	49	0	0	3
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	001925SMH	X	1718	POTOMAC GREENS	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		65	66	0	0	4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	001926SMH	X	1706	POTOMAC GREENS	Easement	07/12/2013	07/12/2013	Truck 1	1		57	58	0	0	4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
Potomac	001927SMH	X	704	CARPENTER RD	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		48	49	0	0	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chimney/Shelf	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shelf	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Frame Base Seal	Cracked / deteriorated			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Frame Base Seal	Corroded, pitted, spalled			Min: <10% mat'l loss, <3/8" (1cm) etching	Structural					
					Frame Base Seal	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	001928SMH	X	1706	POTOMAC GREENS	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		48	49	0	0	3
					Frame Base Seal	Cracked / deteriorated			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Frame Base Seal	Corroded, pitted, spalled			Min: <10% mat'l loss, <3/8" (1cm) etching	Structural					
					Frame Base Seal	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chimney/Shelf	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chimney/Shelf	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shelf	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	002074ND	X	2801	MAIN LINE BV		07/18/2013	07/18/2013	Truck 1	1	Not found	0	0	0	0	0
Potomac	002078ND	X	901	ROYAL ST		08/09/2013	08/09/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	002080ND	X	3601	POTOMAC AV		08/15/2013	08/15/2013	Truck 1	1	No Access	0	0	0	0	0
Potomac	002346SMH	X	601	N FAIRFAX ST	Sidewalk	08/09/2013	08/09/2013	Truck 1	1		68	67	5	0	3
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Frame Base Seal	Cracked / deteriorated			Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural					
					Frame Base Seal	Corroded, pitted, spalled			Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching	Structural					
					Frame Base Seal	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chimney/Shelf	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shelf	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Bench	Debris/deposition			Mod: 1-3gal bucket	Maintenance					
Potomac	002350SMH	X	990	N LEE ST	Light Highway Rural Streets	08/09/2013	08/09/2013	Truck 1	1		53	54	0	0	4
					Chamber	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Frame Base Seal	Corroded, pitted, spalled			Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural					
					Frame Base Seal	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chimney/Shelf	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
Potomac	002351SMH	X	66	CANAL CENTER PZ	Light Highway Rural Streets	08/09/2013	08/09/2013	Truck 1	1		47	48	0	0	3
					Chimney/Shelf	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shelf	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	002352SMH	X	66	CANAL CENTER PZ	Light Highway Rural Streets	08/09/2013	08/09/2013	Truck 1	1		51	52	0	0	4
Potomac	002379SMH	X	1111	N FAIRFAX ST	Yard-Back	08/09/2013	08/09/2013	Truck 1	1		68	69	0	0	4
Potomac	002380SMH	X	1111	N FAIRFAX ST	Yard-Back	08/09/2013	08/09/2013	Truck 1	1		42	43	0	0	3
Potomac	002385SMH	X	901	N ROYAL ST	Easement	08/09/2013	08/09/2013	Truck 1	1		49	47	5	0	2
Potomac	002386SMH	X	901	N ROYAL ST	Easement	08/09/2013	08/09/2013	Truck 1	1		61	62	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	002432SMH	X	1400	ARGALL PL	Easement	08/01/2013	08/01/2013	Truck 1	1		41	41	0	0	3
Potomac	002433SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		31	31	0	0	3
Potomac	002435SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		70	52	50	0	3
Potomac	002436SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		71	53	50	0	2
Potomac	002437SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		70	52	50	0	2
Potomac	002441SMH	X	1400	ARGALL PL	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		47	47	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	002444SMH	X	917	PORTNER PL	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		73	54	50	0	3
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance							
Potomac	002445SMH	X	916	PORTNER PL	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		72	50	50	0	2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
Potomac	002447SMH	X	1401	PORTNER RD	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		67	39	50	0	4
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance							
Potomac	002448SMH	X	916	BERNARD ST	Light Highway Rural Streets	08/01/2013	08/01/2013	Truck 1	1		76	76	15	0	5
				Frame Base Seal	Cracked / deteriorated	Extreme: >3/4" (20mm) width		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Potomac	002450SMH	X	921	BERNARD ST	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes																																																																																																																																																																																				
Potomac	002455SMH	X	1400	ARGALL PL		11/18/2014	11/18/2014	Truck 1	1		0	0	0	0	0																																																																																																																																																																																				
Potomac	002471SMH	X	100	MADISON ST	Yard-Back	08/09/2013	08/09/2013	Truck 1	1		68	69	0	0	2																																																																																																																																																																																				
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Chamber</td><td style="width: 10%;">Corroded, pitted, spalled</td><td style="width: 10%;">Min: <10% mat'l loss, etching</td><td style="width: 10%;">Structural</td><td colspan="11"></td></tr> <tr> <td>Chamber</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Channel</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Channel</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Channel</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Corroded, pitted, spalled</td><td>Mod:10-25% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Bench</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Bench</td><td>Corroded, pitted, spalled</td><td>Mod:10-25% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Bench</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, <3/8" (1cm) etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> </table>	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural												Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural												Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural												Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I											
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																
Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																
Chimney/Shft	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural																																																																																																																																																																																																
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																
Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching	Structural																																																																																																																																																																																																
Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural																																																																																																																																																																																																
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Potomac	002493SMH	X	100	MADISON ST	Yard-Back	08/09/2013	08/09/2013	Truck 1	1		52	53	0	0	2																																																																																																																																																																																				
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Chamber</td><td style="width: 10%;">Corroded, pitted, spalled</td><td style="width: 10%;">Min: <10% mat'l loss, etching</td><td style="width: 10%;">Structural</td><td colspan="11"></td></tr> <tr> <td>Chamber</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, <3/8" (1cm) etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> </table>	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural												Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																					
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural																																																																																																																																																																																																
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Potomac	002694SMH	X	727	CARPENTER RD	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		51	52	0	0	2																																																																																																																																																																																				
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td><td style="width: 10%;">Cracked / deteriorated</td><td style="width: 10%;">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td style="width: 10%;">Structural</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, <3/8" (1cm) etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Chamber</td><td>Corroded, pitted, spalled</td><td>Min: <10% mat'l loss, etching</td><td>Structural</td><td colspan="11"></td></tr> <tr> <td>Chamber</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> </table>	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural												Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural												Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural												Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																					
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural																																																																																																																																																																																																
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																																																																																																																																
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Potomac	002976SMH	X	600	S UNION ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		53	53	5	0	3																																																																																																																																																																																				
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td><td style="width: 10%;">Corroded, pitted, spalled</td><td style="width: 10%;">Min: <10% mat'l loss, <3/8" (1cm) etching</td><td style="width: 10%;">Structural</td><td colspan="11"></td></tr> <tr> <td>Frame Base Seal</td><td>I/I evidence</td><td>Min: <1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td colspan="11"></td></tr> <tr> <td>Chimney/Shft</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td colspan="11"></td></tr> </table>	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural												Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I												Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																	
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural																																																																																																																																																																																																
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																																																																																																																																
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																																																																																																																																

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Potomac	002977SMH	X	100	GIBBON ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		56	56	0	0	3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	002979SMH	X	100	GIBBON ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		54	55	0	0	3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Potomac	002983SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		46	47	0	0	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	002984SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		5	5	0	0	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Potomac	002985SMH	X	501	S UNION ST	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		41	41	0	0	3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Potomac	002987SMH	X	101	POMMANDER WALK ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		51	52	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	003006SMH	X	99	FRANKLIN ST	Light Highway Rural Streets	08/23/2013	08/23/2013	Truck 1	1		54	55	0	0	4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	003055SMH	X	1011	BASHFORD LA	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		50	51	0	0	4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	003056SMH	X	1200	N FAYETTE ST	Parking Lot	08/23/2013	08/23/2013	Truck 1	1		70	46	50	0	2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	004111SMH	X	1738	CARPENTER RD	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		56	57	0	0	4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	004112SMH	X	701	DAY LA	Light Highway Rural Streets	07/12/2013	07/12/2013	Truck 1	1		51	52	0	0	4
Potomac	004115SMH	X	901	ROYAL	Light Highway Rural Streets	08/09/2013	08/09/2013	Truck 1	1		51	52	0	0	3
Potomac	004122SMH	X	600	UNION ST		11/18/2014	11/18/2014	Truck 1	1		0	0	0	0	0
Potomac	004800SMH	X	2400	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	1
Potomac	004801SMH	X	2400	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	3
Potomac	004802SMH	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004803SMH	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004804SMH	X	2400	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004805SMH	X	2400	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004806SMH	X	2000	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004807SMH	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004808SMH	X	700	CUSTIS AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	3
Potomac	004809SMH	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004810SMH	X	734	DIAMOND AV		11/03/2014	11/03/2014	Truck 1	1		0	0	0	0	1
Potomac	004811SMH	X	722	DIAMOND AV		11/03/2014	11/03/2014	Truck 1	1		0	0	0	0	2
Potomac	004812SMH	X	734	DIAMOND AV		11/03/2014	11/03/2014	Truck 1	1		0	0	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	004813SMH	X	734	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004814SMH	X	700	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004815SMH	X	700	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004816SMH	X	1801	MAIN LINE BV		11/18/2014	11/18/2014	Truck 1	1		0	0	0	0	0
Potomac	004817SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004818SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004819SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004820SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004821SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004822SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	3
Potomac	004823SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004824SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	004825SMH	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	3
Potomac	004826SMH	X	2000	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	1
Potomac	004829SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	3
Potomac	004830SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	3
Potomac	004831SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004832SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004833SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004834SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	3
Potomac	004835SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004836SMH	X	2401	POTOMAC AV	Sidewalk	08/15/2013	08/15/2013	Truck 1	1	Other	0	0	0	0	2
Potomac	004837SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004838SMH	X	2501	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004839SMH	X	2424	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004840SMH	X	2424	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004841SMH	X	2224	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004842SMH	X	2200	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004843SMH	X	712	CUSTIS AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004844SMH	X	700	CUSTIS AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004846SMH	X	734	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004848SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	3
Potomac	004849SMH	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004850SMH	X	2501	MAIN LINE BV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	004851SMH	X	2401	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Potomac	004852SMH	X	717	MCKENZIE AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004853SMH	X	2501	MAIN LINE BV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	3	
Potomac	004854SMH	X	726	DIAMOND AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004855SMH	X	728	DIAMOND AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004856SMH	X	2024	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004857SMH	X	2100	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004858SMH	X	2401	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2	
Potomac	004859SMH	X	1551	POTOMAC GREENS DR		08/01/2013	08/01/2013	Truck 1	2	Not found	0	0	0	0	0	
Potomac	004861SMH	X	1400	ARGALL PL	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		50	51	0	0	0	
						Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
						Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Potomac	004862SMH	X	1099	PITT ST	Sidewalk	08/09/2013	08/09/2013	Truck 1	1		61	62	0	0	3	
						Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
						Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
						Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural					
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Potomac	005141IN	X	1	CANAL CENTER PZ	Easement	08/09/2013	08/09/2013	Truck 1	1		41	41	0	0	2	
Steps	Broken / missing / deteriorated	Min: 1-2 broken, missing			Structural											
Steps	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural											
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											
Potomac	005146IN	X	1199	N FAIRFAX ST	Sidewalk	08/09/2013	08/09/2013	Truck 1	1		44	45	0	0	5	
						Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Potomac	005155IN	X	701	N FAIRFAX ST	Sidewalk	08/09/2013	08/09/2013	Truck 1	1		50	50	0	0	1	
Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural											
Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural											

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	005326IN	X	520	S LEE ST	Chamber I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				42	42	0	0	1
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
					Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
Potomac	005328IN	X	101	POMMANDER WALK ST	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		48	49	0	0	2
					Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
					Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
Potomac	005351IN	X	719	S UNION ST	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		0	0	0	0	4
Potomac	005353IN	X	99	FRANKLIN ST	Curb/Gutter	08/23/2013	08/23/2013	Truck 1	1		61	42	40	0	3
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I								
					Pipe Connection-3 Roots Intrusion	Extreme: >3/16" (4mm) dia. fingers, >3/4" (2cm) runners or tap dia	Maintenance								
Potomac	005355IN	X	99	FRANKLIN ST	Curb/Gutter	08/23/2013	08/23/2013	Truck 1	1		52	53	0	0	4
					Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
Potomac	006484IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		0	0	0	0	2
Potomac	006485IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		42	38	5	0	2
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
					Debris/deposition	Min: <1gal bucket	Maintenance								
Potomac	006486IN	X	1600	W ABINGDON DR	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		37	38	0	0	2
					Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
					Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
					I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	006488IN	X	1800	W ABINGDON DR	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		0	0	0	0	2
Potomac	006502IN	X	1800	W ABINGDON DR	Sidewalk	07/12/2013	07/12/2013	Truck 1	1		45	46	0	0	2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	006510IN	X	815	SLATERS LA	Easement	08/01/2013	08/01/2013	Truck 1	1		26	26	0	0	2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	007189IN	X	916	BERNARD ST	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		68	42	50	0	2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Potomac	007195IN	X	921	BERNARD ST	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		54	55	0	0	3
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Potomac	007203IN	X	828	SLATERS LA	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		37	38	0	0	3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Potomac	007252IN	X	100	MADISON ST	Yard-Back	08/09/2013	08/09/2013	Truck 1	1		42	42	0	0	3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Potomac	007813IN	X	1400	ARGALL PL	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		37	38	0	0	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	007816IN	X	1010	BASHFORD LA	Cracked	Chamber	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							
					I/I evidence	Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	007816IN	X	1010	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		52	53	0	0	0	2
Potomac	007817IN	X	1009	DOUGLAS ST	Cracked	Chimney/Shelf	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chimney/Shelf	Min: <10% mat'l loss, etching	Structural							
					Mortar missing	Chimney/Shelf	Min: <10% of area	Structural							
					I/I evidence	Chimney/Shelf	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	007817IN	X	1009	Sidewalk	08/23/2013	08/23/2013	Truck 1	1		37	38	0	0	0	2
Potomac	007818IN	X	1009	DOUGLAS ST	Cracked	Chamber	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							
					I/I evidence	Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	007821IN	X	1200	N FAYETTE ST	Cracked	DOUGLAS ST	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							
Potomac	007824IN	X	1200	N FAYETTE ST	Cracked	DOUGLAS ST	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							
					I/I evidence	Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Potomac	007825IN	X	1200	N FAYETTE ST	Debris/deposition	Channel	Min: <1gal bucket	Maintenance							
					Cracked	Chamber	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							
					I/I evidence	Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Debris/deposition	Bench	Min: <1gal bucket	Maintenance							
Potomac	008058IN	X	3104	JEFFERSON DAVIS HY	Cracked	JEFFERSON DAVIS HY	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Corroded, pitted, spalled	Chamber	Min: <10% mat'l loss, etching	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	008059IN	X	3104	JEFFERSON DAVIS HY	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		37	38	0	0	3
					Chamber	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	008130IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	3
Potomac	008131IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	3
Potomac	008132IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		15	15	0	0	2
					Chimney/Shft	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
Potomac	008133IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		50	51	0	0	2
					Chimney/Shft	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chimney/Shft	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chamber	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	008134IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		26	26	0	0	2
					Chimney/Shft	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	008135IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	2
Potomac	008136IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		26	26	0	0	2
					Chimney/Shft	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
Potomac	008137IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		42	43	0	0	3
					Chimney/Shft	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
Potomac	008138IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	2
Potomac	008139IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	4
Potomac	008155IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		37	38	0	0	3
					Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Structural					
					Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I					
					Pipe Connection-2	Pipe cracked			Mod: 1/16" to 1/8" (2-3mm) width	Structural					
Potomac	008156IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		42	42	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008157IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		37	38	0	0	3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008159IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		26	26	0	0	3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008160IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		63	63	0	0	3
				Frame	Cracked / broken / deteriorated	Maj: 1/8" to 3/16" (3-5mm) width		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008162IN	X	2801	MAIN ST	Parking Lot	07/18/2013	07/18/2013	Truck 1	1		47	48	0	0	3
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Steps	Broken / missing / deteriorated	Min: 1-2 broken, missing		Structural							
Potomac	008167IN	X	3006	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		46	47	0	0	2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008168IN	X	3104	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		56	57	0	0	2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Potomac	008169IN	X	3104	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		35	35	0	0	1
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	008170IN	X	3006	JEFFERSON DAVIS HY	Sidewalk	07/18/2013	07/18/2013	Truck 1	1		49	50	0	0	2
				Pipe Connection-1	I/I evidence				I/I						
				Chamber	I/I evidence				I/I						
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
Potomac	008199IN	X	710	NORFOLK LA	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	2
Potomac	008201IN	X	1551	POTOMAC GREENS DR	Sidewalk	08/01/2013	08/01/2013	Truck 1	1		0	0	0	0	3
Potomac	008207IN	X	1551	POTOMAC GREENS DR	Parking Lot	08/01/2013	08/01/2013	Truck 1	1		56	57	0	0	4
				Chimney/Shft	Cracked				Structural						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
				Chimney/Shft	I/I evidence				I/I						
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
Potomac	008281IN	X	708	CARPENTER RD	Alley	07/12/2013	07/12/2013	Truck 1	1		78	78	0	0	4
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
				Frame Base Seal	Cracked / deteriorated				Structural						
				Frame Base Seal	Corroded, pitted, spalled				Structural						
				Frame Base Seal	I/I evidence				I/I						
Potomac	008282IN	X	700	CARPENTER RD	Sidewalk	07/12/2013	07/12/2013	Truck 1	1		48	49	0	0	5
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
Potomac	008283IN	X	716	CARPENTER RD	Sidewalk	07/12/2013	07/12/2013	Truck 1	1		50	51	0	0	3
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
				Chimney/Shft	Cracked				Structural						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
				Chimney/Shft	I/I evidence				I/I						
Potomac	008286IN	X	700	CARPENTER RD	Sidewalk	07/12/2013	07/12/2013	Truck 1	1		26	26	0	0	4
				Chamber	I/I evidence				I/I						
				Chamber	Corroded, pitted, spalled				Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Potomac	009249IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	2
Potomac	009250IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	3
Potomac	009252IN	X	2401	POTOMAC AV	Easement	08/15/2013	08/15/2013	Truck 1	1		0	0	0	0	2
Potomac	009800IN	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009801IN	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009802IN	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009804IN	X	2203	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009805IN	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009807IN	X	2113	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009809IN	X	734	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009810IN	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009811IN	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009812IN	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009813IN	X	2401	POTOMAC AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009814IN	X	1801	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	1
Potomac	009815IN	X	2200	MAIN LINE BV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009817IN	X	734	HOWELL AV		10/30/2014	10/30/2014	Truck 1	1		0	0	0	0	2
Potomac	009820IN	X	2401	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	009821IN	X	2401	POTOMAC AV		11/03/2014	11/03/2014	Truck 1	1	Other	0	0	0	0	2
Potomac	009824IN	X	901	ROYAL ST	Sidewalk	08/09/2013	08/09/2013	Truck 1	1		49	50	0	0	3

Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural
Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I

Appendix C – Summary of Structures Not Inspected

Facility ID	Why Not Inspected
000195ND	No Access
000469ND	No Access
000656ND	No Access
000470ND	No Access
000462ND	No Access
000461ND	No Access
000296ND	No Access
000292ND	No Access
000298ND	No Access
000293ND	No Access
000294ND	No Access
000295ND	No Access
000291ND	No Access
000297ND	No Access
000309ND	No Access
000275ND	No Access
001504IN	No Access
000472ND	No Access
000465ND	No Access
000464ND	No Access
000466ND	No Access
000202ND	No Access
000452ND	No Access
000192ND	No Access
000234ND	No Access
000222ND	No Access
000196ND	No Access
000206ND	No Access
000197ND	No Access
000471ND	No Access
000453ND	No Access
000302ND	No Access
000657ND	No Access
000042ND	No Access
000049ND	No Access
000047ND	No Access
000052ND	No Access
000299ND	No Access
000300ND	No Access
000447ND	No Access
000463ND	No Access
0001052ND	No Access
0001055ND	No Access
0001062ND	No Access
0001093ND	No Access
000872ND	No Access
000877ND	No Access
001018ND	No Access
001019ND	No Access
001104ND	No Access

Facility ID	Why Not Inspected
001107ND	No Access
001108ND	No Access
001109ND	No Access
001120ND	No Access
001123ND	No Access
002078ND	No Access
002079ND	No Access
002080ND	No Access
000017CD	Not Found
000411IO	Not Found
000469IO	Not Found
000471IO	Not Found
000491IO	Not Found
001119ND	Not Found
001124ND	Not Found
001125ND	Not Found
002074ND	Not Found
004859SMH	Not Found
004829SMH	Potomac Yards Area
004830SMH	Potomac Yards Area
004831SMH	Potomac Yards Area
004832SMH	Potomac Yards Area
004833SMH	Potomac Yards Area
004834SMH	Potomac Yards Area
004835SMH	Potomac Yards Area
004836SMH	Potomac Yards Area
004837SMH	Potomac Yards Area
004838SMH	Potomac Yards Area
004839SMH	Potomac Yards Area
004840SMH	Potomac Yards Area
004841SMH	Potomac Yards Area
004842SMH	Potomac Yards Area
004843SMH	Potomac Yards Area
004844SMH	Potomac Yards Area
004846SMH	Potomac Yards Area
004848SMH	Potomac Yards Area
004849SMH	Potomac Yards Area
004850SMH	Potomac Yards Area
004851SMH	Potomac Yards Area
004852SMH	Potomac Yards Area
004853SMH	Potomac Yards Area
004854SMH	Potomac Yards Area
004855SMH	Potomac Yards Area
004856SMH	Potomac Yards Area
004857SMH	Potomac Yards Area
004858SMH	Potomac Yards Area
009820IN	Potomac Yards Area
009821IN	Potomac Yards Area

Appendix D - Summary of Observed Pipe Defects

SCREAM™ Lamping - Summary of Observed Defects

Alexandria - Potomac River

Pipe	SCREAM Total Score	USMH Bldg	MH Street	Observed	Maintenance	Structural	
				Infiltration (Count)	Roots (Length)	Collapsed (Count)	Displaced (Count)
<u>008167IN-008162IN</u>	13	3601	JEFFERSON DAVIS HY	1	0	0	0
<u>008155IN-008156IN</u>	13	3601	JEFFERSON DAVIS HY	1	0	0	0
<u>001859SMH-</u>	13	3601	JEFFERSON DAVIS HY	1	0	0	0
<u>001864SMH-</u>	13	3000	JEFFERSON DAVIS HY	1	0	0	0
<u>005138IN-</u>	25	1055	FAIRFAX ST	0	0	0	1
<u>005137IN-</u>	100	1111	FAIRFAX ST	0	0	1	0
<u>005353IN-005355IN</u>	100	99	FRANKLIN ST	0	4	0	0
Total				4	4	1	1

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.